

Jacobsen GP400



(https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786419/big_8fdaec400a8f60f249344605506b7c54.jpg)



([https://panda-assets-](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786419/big_8fdaec400a8f60f249344605506b7c54.jpg)

[live.s3.amazonaws.com/uploads/document/image/3786419/big_8fdaec400a8f60f249344605506b7c54.jpg](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786419/big_8fdaec400a8f60f249344605506b7c54.jpg))



(<https://panda-assets->

[live.s3.amazonaws.com/uploads/document/image/3786420/big_427112bec146e1571b3d8e1e5d928d9f.jpg](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786420/big_427112bec146e1571b3d8e1e5d928d9f.jpg))



(<https://panda-assets->

[live.s3.amazonaws.com/uploads/document/image/3786421/big_09e75ef3fa29fb85fe1f335e1895e55d.jpg](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786421/big_09e75ef3fa29fb85fe1f335e1895e55d.jpg))



(<https://panda-assets->

[live.s3.amazonaws.com/uploads/document/image/3786422/big_bdb9de1e42a13ab6a323fcabc8517323c.jpg](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786422/big_bdb9de1e42a13ab6a323fcabc8517323c.jpg))



(<https://panda-assets->

[live.s3.amazonaws.com/uploads/document/image/3786423/big_3ebc0c1280531644735418d242ed6d2b.jpg](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786423/big_3ebc0c1280531644735418d242ed6d2b.jpg))



(<https://panda-assets->

[live.s3.amazonaws.com/uploads/document/image/3786424/big_d6357c030f06ae5f8f5498ef3e1dd978.jpg](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786424/big_d6357c030f06ae5f8f5498ef3e1dd978.jpg))



(<https://panda-assets->

[live.s3.amazonaws.com/uploads/document/image/3786425/big_c3146c28da7f5ec342e2e4edd7b0d626.jpg](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786425/big_c3146c28da7f5ec342e2e4edd7b0d626.jpg))



([https://panda-assets-](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786426/big_c8040db3b78823252911f1365970d88.jpg)

[live.s3.amazonaws.com/uploads/document/image/3786426/big_c8040db3b78823252911f1365970d88.jpg](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786426/big_c8040db3b78823252911f1365970d88.jpg))



([https://panda-assets-](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786427/big_29f602a8dde7bf7bc8e360eded9a563d.jpg)

[live.s3.amazonaws.com/uploads/document/image/3786427/big_29f602a8dde7bf7bc8e360eded9a563d.jpg](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786427/big_29f602a8dde7bf7bc8e360eded9a563d.jpg))



([https://panda-assets-](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786428/big_dbbfd0b4a1a79c326f6979fdcfab6b1a.jpg)

[live.s3.amazonaws.com/uploads/document/image/3786428/big_dbbfd0b4a1a79c326f6979fdcfab6b1a.jpg](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786428/big_dbbfd0b4a1a79c326f6979fdcfab6b1a.jpg))



([https://panda-assets-](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786429/big_769f6bab77a20b7c1a38465e4add2fc7.jpg)

[live.s3.amazonaws.com/uploads/document/image/3786429/big_769f6bab77a20b7c1a38465e4add2fc7.jpg](https://panda-assets-live.s3.amazonaws.com/uploads/document/image/3786429/big_769f6bab77a20b7c1a38465e4add2fc7.jpg))

SPECIFICATIONS

Hours: 3191

Year/Make/Model: Jacobsen GP400

S/N: 6270610837

Location: Locust, NC

<https://reports.assetiqfinancial.com>

Copy text

Full Specs

IDENTIFICATION

Description: Normal working condition, 15 Blade Reel

S/N: 6270610837

Year, Make, Model: Jacobsen GP400

Hours: 3191

APPRAISAL

Low Appraisal Value: \$0.00

High Appraisal Value: \$0.00

Repair Cost: \$0.00

EQUIPMENT INSPECTION

Inspection Date: 2021-02-12

Hours (If Applicable): 3191

Front Body Panels: Average Condition (Some Scratches)

Seat / Frame: Poor Condition

Canopy / Cab:

Gauges: Normal Working Condition

Machine Frames: Normal Condition

Reels / Head: 15 Blade

Engine Type: Gasoline

HP:

PTO/Transmission: Normal Working Condition

Electric Motors:

Additional Comments:

Screws for instrument panel are missing. Seat is cracked on left hand side. Heavy rust on reels and rollers. Reels will raise and lower but will not engage. Low on hydraulic fluid. Radiator is rusty on bottom edge.

Wheel Drive: 2WD

Accessories Included:

Rear Body Panels: Average Condition (Some Scratches)

Wheels / Tires / Tracks: Average Condition (Worn)

Rollers / Reels / Decks Attachments: Poor Condition (Rusty)

Machine Controls: Normal Working Condition

Brakes: Average Condition (Normal Wear)

Tines:

MFG:

Engine Condition: Normal Working Condition

Drive Belts:

Hydraulics:
