



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSPECTOR: 5657
INSPECTION ID
141660

INSP DATE	UNIT NUMBER	VIN (LAST 8)	PO NUMBER
05/18/2021	1	J3081082	

Year	2018	Make	VAN HOOL
Model	CX45	VIN	YE2XC81BXJ3081082

SPECIFICATION WORKSHEET

Interior Options Interior Color: BLACK / GRAY	Steering Options Power Steering?: Yes
---	---

Engine Options A Eng Make: DETROIT Eng Model: DD13 Eng Serial: 471941S0539173 Eng HP: 450 Cruise: Yes Clean air idle: No	Overall Condition Overall Length: 45" Overall Height: 11' 6" Overall Width: 102"
---	--

Engine Options B Odometer: 68337 Hub odometer: ECU HP: 450 ECU Miles: 67350 Eng Hours: 2593	Miscellaneous Seating Capacity: 56 Electronic Engine Controls: Yes Full Gauge Package: Yes Wraparound Dash: Yes Power Mirrors: Yes Tilt / Telescopic Steering Wheel: Yes AirRide Driver's Seat: Yes Restroom: Yes PA System: Yes Audio - Video System: Yes Number of Video Monitors: 6 Multi-Disc CD Changer: Yes Individual multi-Channel Audio System: No Global Positioning System: No In Motion Satellite TV System: No Road Viewing Monitor System: Yes Wheelchair Lift: No Underfloor Storage with Lift: Yes Parcel Rack Storage with Lift: Yes Traction Control: Yes Power Windshield Sun Visors: Yes Tour Guide Seat: No Other: Was Unit driven In?: Yes Did Unit need to be jump started?: Yes Was Unit towed in?: No Did Unit start and run?: Yes Unit Condition: GOOD If Unit is not driveable or will not start, Explain: Any extra options or features not listed on front page and any additional comments: EQUIPPED WITH 110V OUTLETS WITH USB PORTS AT SEATS
---	--

Engine Options C Eng Brake: JAKE Fuel: DIESEL FT1 Capac (Gal): 220
--

Exterior Options A Air Horns: SINGLE Mirrors: HEATED DUAL POWER Exterior Color: WHITE

Axle / Susp Options WheelBase (In): 304" Rear Ratio: ID TAG NOT AVAILABLE F Axle (lbs): 17640 R Axle (lbs): 27575 GVWR (lbs): 54000 Suspension: AIR RIDE Tag Axle Capacity: 17640 Rear Axle Model: ID TAG NOT AVAILABLE Independent Front Suspension: Yes Full Coach Raise and Lowering Susp.: Yes Tag Axle Unloading System: No Front Susp. Kneeling System: Yes
--

Transmission Options Trans Make: ALLISON Trans Model: B500 5TH GENERATION Trans Speed: 6
--



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSPECTOR: 5657
INSPECTION ID
141660

INSP DATE	UNIT NUMBER	VIN (LAST 8)	PO NUMBER
05/18/2021	1	J3081082	

Brakes Options

ABS:	YES
HYD:	NO
AIR:	YES
DISK:	YES
DRUM:	NO
Brake Plates:	FRONT Y / REAR Y

Tires [Front]

Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	GOODYEAR MARATHON LHS

Brakes

Steer Axle Brakes:	50%	50%	(1)
Drive Axle Brakes:	50%	50%	(2)
	50%	50%	(3)
			(4)
			(5)
			(6)

Tires [Rear]

Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	GOODYEAR MARATHON LHS

	STEER AXLE	DRIVE AXLE #1	DRIVE AXLE #2
		12 / 32nd HIGHWAY / V	/ 32nd /
RIGHT	13 / 32nd HIGHWAY / V 	 	 
FRONT		11 / 32nd HIGHWAY / V	14 / 32nd HIGHWAY / V
		10 / 32nd HIGHWAY / V	17 / 32nd HIGHWAY / V
LEFT		 12 / 32nd HIGHWAY / V	 
		10 / 32nd HIGHWAY / V	/ 32nd /

Brake Legend

BD = DRUM HAS MORE THAN 1/16 INCH LIP
CL = CRACKED LINING
LS = LEAKING SEAL(S)

Tire Legend

C = CUT D = DRY ROT F = FLAT
M = MISMATCHED TIRES/CASING
MA = MISMATCHED AXLES (FRONT vs.
REAR)
V = VIRGIN W = IRREGULAR WEAR
R = RECAP: 1 = ONCE, 2 = TWICE, 3 = 3 TIMES

Tread Legend

H = HIGHWAY L = LUG



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSPECTOR: 5657
INSPECTION ID
141660

INSP DATE	UNIT NUMBER	VIN (LAST 8)	PO NUMBER
05/18/2021	1	J3081082	

CONDITION REPORT

Engine Compartment Area			COMMENTS	
Operational Test			COMMENTS	
X	Batteries - Capable of Starting Engine	UNIT NEEDED JUMP STARTED – WOULD NOT RE-START AFTER RUNNING		
In Cab Inspection			COMMENTS	
Outside Inspection			COMMENTS	
Under Vehicle Inspection			COMMENTS	
Tires/Wheels/Brakes			COMMENTS	
Additional Services		Requested	Status	Comments



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSPECTOR: 5657
INSPECTION ID
141660

INSP DATE	UNIT NUMBER	VIN (LAST 8)	PO NUMBER
05/18/2021	1	J3081082	

RECONDITIONING AND SUPPLEMENTAL ESTIMATE

ITEM	DESCRIPTION / COMMENTS
Batteries - Capable of Starting Engine	X UNIT NEEDED JUMP STARTED - WOULD NOT RE-START AFTER RUNNING
ACTIVE / INACTIVE FAULT CODES	PRESENT

COMMENTS:




DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE	UNIT NUMBER	VIN (LAST 8)	PO NUMBER
05/18/2021	1	J3081082	

INSPECTOR: 5657
INSPECTION ID
141660

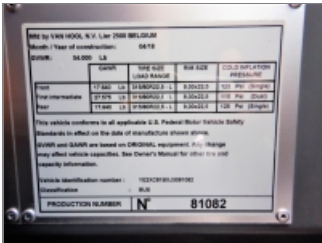

VIN



DASH W/ STEERING WHEEL



LEFT SIDE



FRONT LEFT CORNER



FRONT OF BUS



FRONT RIGHT CORNER



RIGHT SIDE



REAR RIGHT CORNER



RIGHT REAR TIRES



REAR OF BUS



REAR LEFT CORNER



LEFT REAR TIRES



ENTRY WAY STEPS AT FRONT
DOOR



COMPLETE DRIVERS SEAT



ODOMETER



INSIDE OF BUS, FRONT TO
BACK



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE	UNIT NUMBER	VIN (LAST 8)	PO NUMBER
05/18/2021	1	J3081082	

INSPECTOR: 5657
INSPECTION ID
141660



FLOOR OF BUS, FRONT TO BACK



INSIDE OF BUS, BACK TO FRONT



FLOOR OF BUS, BACK TO FRONT



INSIDE RESTROOM #1



SEATS




LEFT STEER TIRE




RIGHT STEER TIRE




ENGINE COMPARTMENT

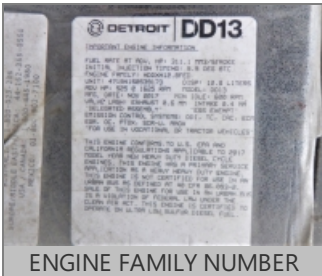

ENGINE FAMILY NUMBER

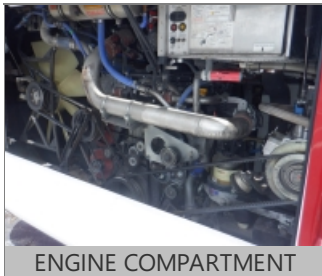

ENGINE COMPARTMENT
RIGHT SIDE

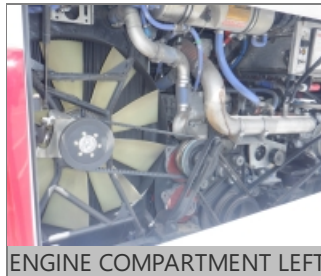

ENGINE COMPARTMENT LEFT
SIDE



INSIDE STORAGE
COMPARTMENTS



ADDITIONAL 1



ADDITIONAL 2



ADDITIONAL 3



ADDITIONAL 4



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE	UNIT NUMBER	VIN (LAST 8)	PO NUMBER
05/18/2021	1	J3081082	

INSPECTOR: 5657
INSPECTION ID
141660




ADDITIONAL 5



ADDITIONAL 6



ADDITIONAL 7

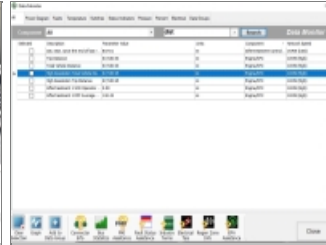


ADDITIONAL 8



ADDITIONAL 9



ADDITIONAL 10

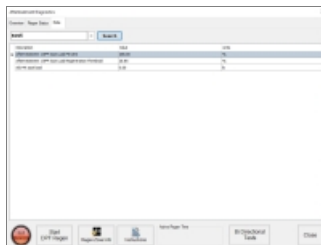

ADDITIONAL 11



ADDITIONAL 12



ADDITIONAL 13



ADDITIONAL 14