





🔁 Download Reconditioning Printout

UNIT SPECS


Wells Fargo (IMS) Customer


LOCATION


WELLS FARGO (IMS) PLEASE CALL PICKUP SUPPORT FOR LOCATION INFORMATION LONGMONT, CO 80504





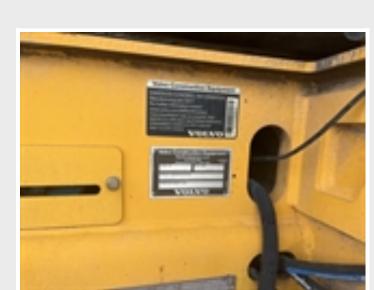

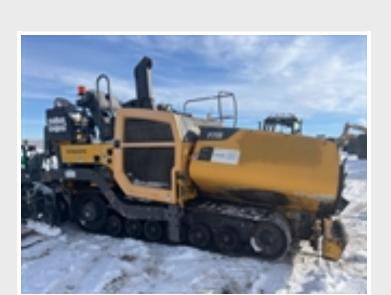

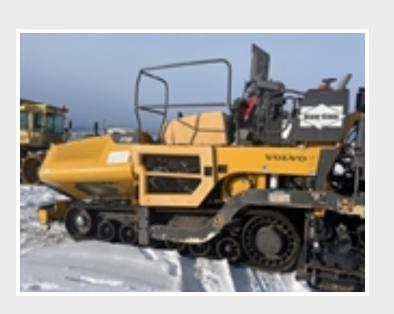

▼

O VIEW ALL PHOTOS

FULL SPECS RECONDITIONING

GENERAL APPEARANCE

UID VCEP7110C0S385088

Pre-Operational Checks Confirm Fluids Checked: Engine Coolant. Confirm Fluids Checked: Engine(s) Oil. Confirm Fluids Checked: Transmission Fluid. Confirm Fluids Checked: Hydraulic Fluid. Confirm Fluids Checked: Fuel Level

Overall Condition Overall Condition for Age:, Fair

SAFETY

Travel Alarm Operational Seat Belts Not equipped

Current Safety Manual

CONTROL STATION

Hydraulic Controls Rating Good **Steering Control Rating**

Good Oil Pressure

Screed Control Switches Operational Gauges

Hour Meter/Odometer 7483 hrs, Operational hour meter

ENGINE

Starter Operational Oil Leaks No dripping leaks

Cooling System Leaks No dripping leaks

EPA Conformity Year US EPA Label not legible

Operational

No oil pressure indicator

DRIVETRAIN

Transmission Type (Hydrostatic) Hydrostatic Drive **Transmission Rating** Good Right Final Drive Rating Limited Function Check (Drivetrain - Rubber Tire)

The drivetrain was operational. **HYDRAULICS**

Pumps (Hydraulics) Rating Good Hydraulic Tank Rating

Good Hoses (Hydraulics) Rating Good Screed Angle Cylinders Rating Good

Screed Extension Cylinders

Good Limited Function Check (Hydraulics) The hydraulic system was operational.

CHASSIS

Good

Screed Make and Model Carlson Minimum Paving Width: 10 ft - Maximum Paving Width: 18 ft Screed Screed Bottom Plate/Mat Rating

Metering Gates Rating Good Feed Conveyers Rating Good Truck Hitch Rating

Screed Heaters Rating Good **Screed Crown Adjustment Rating** Good

Extension Tubes Good Spray Down System Rating Good

UNDERCARRIAGE Left Track Belt Condition Damage to the inside of the track belts

Left Rubber Belt Drive Lugs

No visible damage

Make and Model Review Track

Exterior Lights Not operational, front two lights lights are not operational

Horn Operational Safety Lock Out/Stop Operational

Steering Control **Dual Controls**

Current Operator/Maintenance Manual

Drivetrain Controls Rating Warning Lights Operational **Screed Control Switches Rating**

Good Hour Meter/Odometer (Start) 7482 hrs Limited Function Check (Control Station)

The main components are in place and operational as noted.

Emission Certification Label Emission label no legible Radiator Good Fuel Leaks No dripping leaks Limited Function Check (Engine) The engine started and ran.

Transmission Operational **Left Final Drive Rating**

Drive Chains/Sprockets

Valves Rating Good

Good

Hydraulic Motors Rating

Hopper Wing Cylinders Rating - IPWeb Spec Good Screed Lift Cylinders Rating Good **Screed Extension Cylinders Rating**

Screed Serial Number Serial Number: 2580FB70

Auger/Screw Rating Good **Push Rollers Rating**

Good

Hopper Wings Rating

Screed Heaters Not operationally checked **Screed Crown Adjustment** Powered adjustment

Good **End Gates Rating** Good Limited Function Check (Paver)

Mat Thickness Adjusters

The main components were operational in a limited check.

Right Track Belt Condition Damage to the inside of the track belts

Right Rubber Belt Drive Lugs No visible damage