



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE | VIN (LAST 8) | PO NUMBER
01/26/2021 | F5171422

INSPECTOR: 5932
INSPECTION ID
135910

Year | Model | 2015 | Make | VIN | 9700 | VOLVO | 3CET2V223F5171422

SPECIFICATION WORKSHEET

Interior Options	
Interior Color:	BLUE

Steering Options	
Power Steering?:	Yes

Engine Options A	
Eng Make:	VOLVO
Eng Model:	D13J435
Eng Serial:	1094917
Eng HP:	435
Cruise:	Yes
Clean air idle:	Yes

Overall Condition	
Overall Length:	45'
Overall Height:	12'
Overall Width:	8'

Engine Options B	
Odometer:	347911
Hub odometer:	NA
ECU HP:	550
ECU Miles:	347911
Eng Hours:	12516

Miscellaneous	
Seating Capacity:	56
Electronic Engine Controls:	Yes
Full Gauge Package:	Yes
Wraparound Dash:	Yes
Power Mirrors:	Yes
Tilt / Telescopic Steering Wheel:	Yes
AirRide Driver's Seat:	Yes
Restroom:	Yes
PA System:	Yes
Audio - Video System:	Yes
Number of Video Monitors:	4
Multi-Disc CD Changer:	Yes
Individual multi-Channel Audio System:	No
Global Positioning System:	Yes
In Motion Satellite TV System:	No
Road Viewing Monitor System:	No
Wheelchair Lift:	No
Underfloor Storage with Lift:	No
Parcel Rack Storage with Lift:	No
Traction Control:	Yes
Power Windshield Sun Visors:	Yes
Tour Guide Seat:	No
Other:	NA
Was Unit driven In ?:	Yes
Did Unit need to be jump started ?:	Yes
Was Unit towed in ?:	No
Did Unit start and run ?:	Yes
Unit Condition:	GOOD
If Unit is not driveable or will not start, Explain:	NA
Any extra options or features not listed on front page and any additional comments:	
NA	

Engine Options C	
Eng Brake:	JAKE
Fuel:	DIESEL
FT1 Capac (Gal):	210

Exterior Options A	
Air Horns:	NONE
Mirrors:	DUAL POWER
Exterior Color:	WHITE

Axle / Susp Options	
WheelBase (In):	315"
Rear Ratio:	2.64
F Axle (lbs):	16,500
R Axle (lbs):	10,800
GVWR (lbs):	49,400
Suspension:	AIR RIDE
Tag Axle Capacity:	22,100
Rear Axle Model:	NA
Independent Front Suspension:	Yes
Full Coach Raise and Lowering Susp.:	No
Tag Axle Unloading System:	Yes
Front Susp. Kneeling System:	Yes

Transmission Options	
Trans Make:	ALLISON
Trans Model:	300/4000 5TH GEN
Trans Speed:	12



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE 01/26/2021 VIN (LAST 8) F5171422 PO NUMBER

INSPECTOR: 5932
INSPECTION ID
135910

Brakes Options

ABS:	YES
HYD:	NO
AIR:	YES
DISK:	YES
DRUM:	NO
Brake Plates:	FRONT N / REAR N

Brakes

Steer Axle Brakes:	50%	50%	(1)
Drive Axle Brakes:	60%	60%	(2)
	60%	60%	(3)
			(4)
			(5)
			(6)

Tires [Front]

Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	

Tires [Rear]

Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	

	STEER AXLE	DRIVE AXLE #1	DRIVE AXLE #2
		9 / 32nd LUG / R1	4 / 32nd LUG / R1
RIGHT	13 / 32nd HIGHWAY / V 	 	 
FRONT		8 / 32nd LUG / R1	/ 32nd /
LEFT	 16 / 32nd HIGHWAY / V	8 / 32nd LUG / R1  	/ 32nd /  
		5 / 32nd LUG / R1	8 / 32nd LUG / R1

Brake Legend

BD = DRUM HAS MORE THAN 1/16 INCH LIP
CL = CRACKED LINING
LS = LEAKING SEAL(S)

Tire Legend

C = CUT D = DRY ROT F = FLAT
M = MISMATCHED TIRES/CASING
MA = MISMATCHED AXLES (FRONT vs.
REAR)
V = VIRGIN W = IRREGULAR WEAR
R = RECAP: 1 = ONCE, 2 = TWICE, 3 = 3 TIMES

Tread Legend

H = HIGHWAY L = LUG



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE | VIN (LAST 8) | PO NUMBER
01/26/2021 | F5171422 |

INSPECTOR: 5932
INSPECTION ID
135910

CONDITION REPORT

	Engine Compartment Area	COMMENTS
	Operational Test	COMMENTS
	In Cab Inspection	COMMENTS
X	Interior Condition/ Seats, Panels, Etc.	DAMAGED SEAT CUSHION
	Outside Inspection	COMMENTS
X	Paint Condition & Physical Damage	BODY DAMAGE
X	Mirrors	LEFT MIRROR COVER DAMAGED
	Under Vehicle Inspection	COMMENTS
	Tires/Wheels/Brakes	COMMENTS
X	Tires/Wheels	6 tires below 10/32

Additional Services	Requested	Status	Comments
---------------------	-----------	--------	----------



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE	VIN (LAST 8)	PO NUMBER
01/26/2021	F5171422	

INSPECTOR: 5932
INSPECTION ID
135910

RECONDITIONING AND SUPPLEMENTAL ESTIMATE

ITEM	DESCRIPTION / COMMENTS
Interior Condition/ Seats, Panels, Etc.	X DAMAGED SEAT CUSHION
Paint Condition & Physical Damage	X BODY DAMAGE
Mirrors	X LEFT MIRROR COVER DAMAGED
Tires/Wheels	X 6 tires below 10/32
FRONT BUMPER	DAMAGED
FRONT PANEL	DAMAGED
ACTIVE CODES	

COMMENTS:
THE BUS WAS INSPECTED AT THE REPO YARD. THE UNIT HAD TO BE JUMPED. THE UNIT WAS IN GOOD RUNNING CONDITION. THERE WAS A ACTIVE CODE DAMAGE FRONT BUMPER, FRONT PANEL, LEFT MIRROR COVER, RIGHT SIDE CARGO DOOR AND SEAT CUSHION.



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE | VIN (LAST 8) | PO NUMBER
01/26/2021 | F5171422

INSPECTOR: 5932
INSPECTION ID
135910



VIN



DASH W/ STEERING WHEEL



LEFT SIDE



FRONT LEFT CORNER



FRONT OF BUS



FRONT RIGHT CORNER



RIGHT SIDE



REAR RIGHT CORNER



RIGHT REAR TIRES



REAR OF BUS



REAR LEFT CORNER



LEFT REAR TIRES



ENTRY WAY STEPS AT FRONT
DOOR



COMPLETE DRIVERS SEAT



ODOMETER



INSIDE OF BUS, FRONT TO
BACK



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE | VIN (LAST 8) | PO NUMBER
01/26/2021 | F5171422 |

INSPECTOR: 5932
INSPECTION ID
135910



FLOOR OF BUS, FRONT TO BACK



INSIDE OF BUS, BACK TO FRONT



FLOOR OF BUS, BACK TO FRONT



INSIDE RESTROOM #1



SEATS




LEFT STEER TIRE



RIGHT STEER TIRE



ENGINE COMPARTMENT

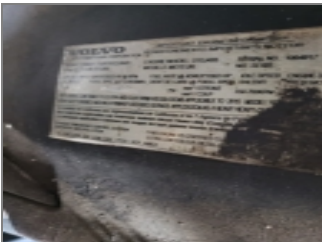

ENGINE FAMILY NUMBER




ENGINE COMPARTMENT
RIGHT SIDE




ENGINE COMPARTMENT LEFT
SIDE



INSIDE STORAGE
COMPARTMENTS

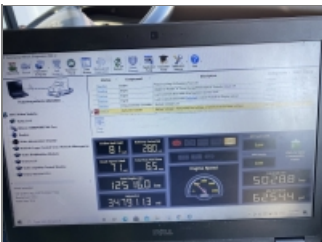

J PRO SCREEN

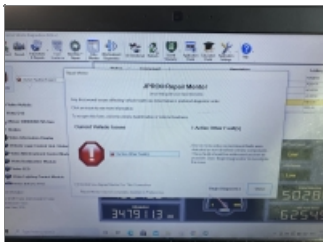

Active Code JPro



ADDITIONAL 1



ADDITIONAL 2



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE | VIN (LAST 8) | PO NUMBER
01/26/2021 | F5171422

INSPECTOR: 5932
INSPECTION ID
135910



ADDITIONAL 3



ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 6



ADDITIONAL 7



ADDITIONAL 8



ADDITIONAL 9



ADDITIONAL 10



ADDITIONAL 11



ADDITIONAL 12