2022 BANDIT 2460

UNIT: 4FMUS422XNR523070






































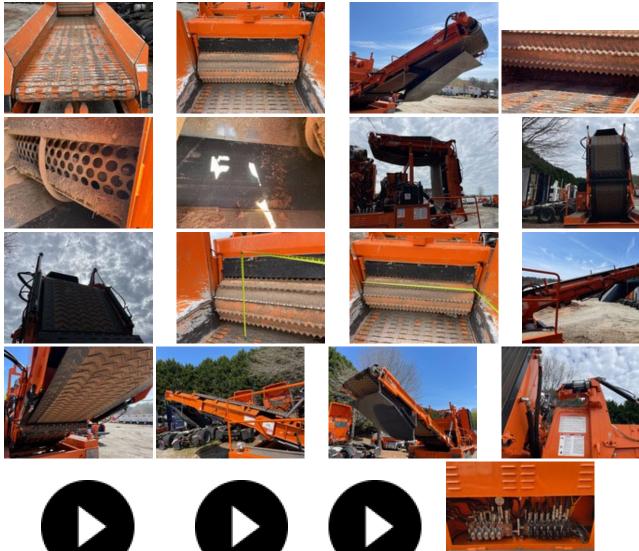





















3

Ou ma internet and it is a second to the second sec





















Bandit










































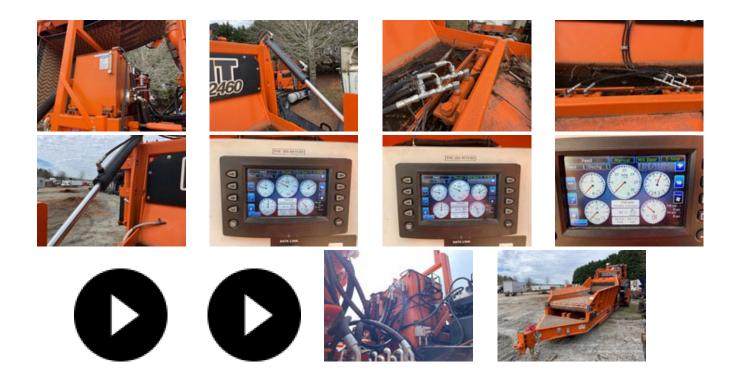

UNIT SPECS

Customer

Wells Fargo (IMS)

LOCATION

Wells Fargo (IMS) Please call Pickup Support for location information Newnan, GA 30265

TRAILER CHASSIS

Frame Rails/ Main Beams Condition No visible damage Rating: Good

Axle Condition Rating: Good

Springs/Hangers Condition Rating: Good

Brake Lines/Hoses Not operationally checked

Limited Function Check - Brakes The brakes were not operationally checked.

Tires Left front outer: 18/32", Left rear outer: 18/32", Right rear outer: 18/32", Right front outer: 18/32" Wheel Condition Rating: Good

Wheel Studs Rating: Good

Tongue/ Hitch Condition No visible damage Rating: Good

Landing Gear / Tongue Jack Rating: Good

Lights/Wiring Condition Not operationally checked

CHASSIS

Feed Table 5 wide feed table, 14 long x Rating: Good

Feeder Drum Rating: Good

Discharge Conveyor Condition Rating: Good

Features 60 in Feeder Chain, 59 in Rotor, 42 in Discharge Conveyor

CONTROL STATION

Hydraulic Controls Rating: Good

Warning Lights Operational

Gauges Operational

Hour Meter (Pre-inspection) 89.7 hrs

Hour Meter 90 hrs

Limited Function Check (Control Station) The main components are in place and operational as noted.

ENGINE

Starter Operational

Radiator Rating: Good

Oil Leaks No dripping leaks

Fuel Leaks No dripping leaks

Cooling System Leaks No dripping leaks

Limited Function Check (Engine) After jump starting, the engine ran. Emissions Status 2021 US EPA Label

Engine Cat C13B 12.5 L Diesel Engine, Requires Diesel Exhaust Fluid

GENERAL APPEARANCE

Year 2022

Make Bandit

Model 2460

Serial Number / VIN 4FMUS42XNR523070

Seller Reference Number Seller Reference or Fleet Number:, 3E182904

Hour Meter / Odometer 90 hrs

Condition Fair

HYDRAULICS

Pumps (Hydraulics) Rating: Good

Valves Rating: Good

Hydraulic Tank Rating: Good

Cylinder(s) Rating: Good

Limited Function Check (Hydraulics) The hydraulic system was operational.

SAFETY

Current Safety Manual No

Current Operator/Maintenance Manual No

CARRIER

Carrier Chassis Number of Axles:, T/A Carrier, Suspension Type:, Spring Suspension, Leveling Jacks, Hydraulic Leveling

MODEL DESCRIPTION

Model Description T/A

RECONDITIONING