



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE	FLEET NAME	UNIT NUMBER	VIN (LAST 8)	PO NUMBER
03/09/2021		5617	H3010283	

INSPECTOR: 5436

INSPECTION ID

137733

Year	2017	Make	SETRA
Model	S417	VIN	WKKA574H7H3010283

SPECIFICATION WORKSHEET

Interior Options	
Interior Color:	BLACK

Steering Options	
Power Steering?:	Yes

Engine Options A	
Eng Make:	DETROIT
Eng Model:	DD13
Eng Serial:	C0240469
Eng HP:	TAG UNREADABLE
Cruise:	Yes
Clean air idle:	Yes

Overall Condition	
Overall Length:	45
Overall Height:	12.3
Overall Width:	102

Engine Options B	
Odometer:	142692
Hub odometer:	
ECU HP:	450
ECU Miles:	141771
Eng Hours:	6646

Engine Options C	
Eng Brake:	JAKE
Fuel:	DIESEL
FT1 Capac (Gal):	NO TAG

Exterior Options A	
Air Horns:	SINGLE
Mirrors:	HEATED DUAL POWER
Exterior Color:	WHITE

Axle / Susp Options	
WheelBase (In):	316
Rear Ratio:	NA
F Axle (lbs):	16530
R Axle (lbs):	20000
GVWR (lbs):	50530
Suspension:	AIR RIDE
Tag Axle Capacity:	14000
Rear Axle Model:	NA
Independent Front Suspension:	Yes
Full Coach Raise and Lowering Susp.:	Yes
Tag Axle Unloading System:	Yes
Front Susp. Kneeling System:	Yes

Transmission Options	
Trans Make:	ALLISON
Trans Model:	3000/4000
Trans Speed:	6

Miscellaneous	
Seating Capacity:	56
Electronic Engine Controls:	Yes
Full Gauge Package:	Yes
Wraparound Dash:	Yes
Power Mirrors:	Yes
Tilt / Telescopic Steering Wheel:	Yes
AirRide Driver's Seat:	Yes
Restroom:	Yes
PA System:	Yes
Audio - Video System:	Yes
Number of Video Monitors:	4
Multi-Disc CD Changer:	No
Individual multi-Channel Audio System:	Yes
Global Positioning System:	No
In Motion Satellite TV System:	No
Road Viewing Monitor System:	No
Wheelchair Lift:	No
Underfloor Storage with Lift:	Yes
Parcel Rack Storage with Lift:	No
Traction Control:	Yes
Power Windshield Sun Visors:	Yes
Tour Guide Seat:	No
Other:	
Was Unit driven In ?:	Yes
Did Unit need to be jump started ?:	No
Was Unit towed in ?:	No
Did Unit start and run ?:	Yes
Unit Condition:	GOOD
If Unit is not driveable or will not start, Explain:	
Any extra options or features not listed on front page and any additional comments: DVD PLAYER-110V W/USB OUTLETS	



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/09/2021

FLEET NAME

UNIT NUMBER

5617

VIN (LAST 8)

H3010283

PO NUMBER

INSPECTOR: 5436

INSPECTION ID

137733

Brakes Options

ABS:	YES
HYD:	NO
AIR:	YES
DISK:	YES
DRUM:	NO
Brake Plates:	FRONT N / REAR N

Brakes

Steer Axle Brakes:	60%	60%	(1)
Drive Axle Brakes:			(2)
	80%	80%	(3)
			(4)
			(5)
			(6)

Tires [Front]

Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	FIRESTONE FS400

Tires [Rear]

Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	

	STEER AXLE	DRIVE AXLE #1	DRIVE AXLE #2
		9 / 32nd HIGHWAY / V	4 / 32nd HIGHWAY / V
RIGHT	13 / 32nd HIGHWAY / V 	 	 
FRONT		12 / 32nd HIGHWAY / V	/ 32nd /
		9 / 32nd HIGHWAY / V	/ 32nd /
LEFT	 14 / 32nd HIGHWAY / V	 	 
		9 / 32nd HIGHWAY / V	4 / 32nd HIGHWAY / V

Brake Legend

BD = DRUM HAS MORE THAN 1/16 INCH LIP
CL = CRACKED LINING
LS = LEAKING SEAL(S)

Tire Legend

C = CUT D = DRY ROT F = FLAT
M = MISMATCHED TIRES/CASING
MA = MISMATCHED AXLES (FRONT vs.
REAR)
V = VIRGIN W = IRREGULAR WEAR
R = RECAP: 1 = ONCE, 2 = TWICE, 3 = 3 TIMES

Tread Legend

H = HIGHWAY L = LUG



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/09/2021

FLEET NAME

UNIT NUMBER

5617

VIN (LAST 8)

H3010283

PO NUMBER

INSPECTOR: 5436

INSPECTION ID

137733

CONDITION REPORT

	Engine Compartment Area	COMMENTS
X	Belt, Alignment, Condition & Adjustment	ALTERNATOR BELT MISSING
X	Belt & Engine Driven Components	ALTERNATOR SEIZED
	Operational Test	COMMENTS
	In Cab Inspection	COMMENTS
	Outside Inspection	COMMENTS
	Under Vehicle Inspection	COMMENTS
	Tires/Wheels/Brakes	COMMENTS
X	Tires/Wheels	5 TIRES LESS THAN 10/32 TREAD

Additional Services	Requested	Status	Comments
---------------------	-----------	--------	----------



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/09/2021

FLEET NAME

UNIT NUMBER

5617

VIN (LAST 8)

H3010283

PO NUMBER

INSPECTOR: 5436

INSPECTION ID

137733

RECONDITIONING AND SUPPLEMENTAL ESTIMATE

ITEM	DESCRIPTION / COMMENTS
Belt, Alignment, Condition & Adjustment	X ALTERNATOR BELT MISSING
Belt & Engine Driven Components	X ALTERNATOR SEIZED
Tires/Wheels	X 5 TIRES LESS THAN 10/32 TREAD
ECU READINGS	INACTIVE FAULTS-REPORT ATTACHED
ENGINE TAG	UNREADABLE
REAR ENGINE DOOR	DAMAGED 2 PLACES
1 RIGHT SIDE LUGGAGE DOOR	SCRATCHED
1 RIGHT SIDE PANEL	SCRATCHED

COMMENTS:

UNABLE TO CHECK/INSPECT REAR AXLES BRAKES AND REAR AXLE MODEL OR RATIO-UNIT IS TO LOW TO GO UNDER BENDIX TIRE PRESSURE MONITOR SYSTEM



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/09/2021

FLEET NAME

UNIT NUMBER

5617

VIN (LAST 8)

H3010283

PO NUMBER

INSPECTOR: 5436

INSPECTION ID

137733



VIN



DASH W/ STEERING WHEEL



LEFT SIDE



FRONT LEFT CORNER



FRONT OF BUS



FRONT RIGHT CORNER



RIGHT SIDE



REAR RIGHT CORNER



RIGHT REAR TIRES



REAR OF BUS



REAR LEFT CORNER



LEFT REAR TIRES



ENTRY WAY STEPS AT FRONT
DOOR



COMPLETE DRIVERS SEAT



ODOMETER



INSIDE OF BUS, FRONT TO
BACK



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/09/2021

FLEET NAME

UNIT NUMBER

5617

VIN (LAST 8)

H3010283

PO NUMBER

INSPECTOR: 5436

INSPECTION ID

137733



FLOOR OF BUS, FRONT TO
BACK



INSIDE OF BUS, BACK TO
FRONT




FLOOR OF BUS, BACK TO
FRONT



INSIDE RESTROOM #1



INSIDE RESTROOM #2

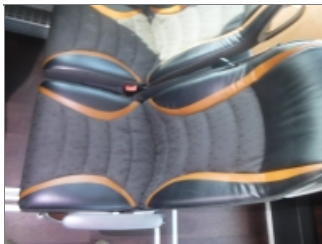

SEATS



LEFT STEER TIRE



RIGHT STEER TIRE



ENGINE COMPARTMENT



ENGINE FAMILY NUMBER



ENGINE COMPARTMENT
RIGHT SIDE



ENGINE COMPARTMENT LEFT
SIDE



INSIDE STORAGE
COMPARTMENTS



ADDITIONAL 1



ADDITIONAL 2



ADDITIONAL 3



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/09/2021

FLEET NAME

UNIT NUMBER

5617

VIN (LAST 8)

H3010283

PO NUMBER

INSPECTOR: 5436

INSPECTION ID

137733



ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 6



ADDITIONAL 7




ADDITIONAL 8



ADDITIONAL 9



ADDITIONAL 10

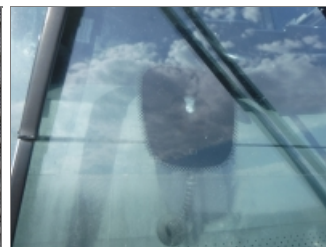

ADDITIONAL 11



ADDITIONAL 12



ADDITIONAL 13



ADDITIONAL 14



ADDITIONAL 15



ADDITIONAL 16



ADDITIONAL 17



ADDITIONAL 18



ADDITIONAL 19



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/09/2021

FLEET NAME

UNIT NUMBER

5617

VIN (LAST 8)

H3010283

PO NUMBER

INSPECTOR: 5436

INSPECTION ID


137733



ADDITIONAL 20



ADDITIONAL 21

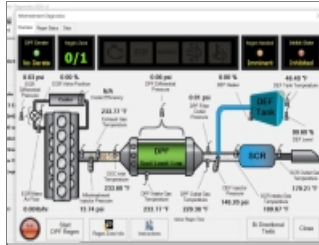


ADDITIONAL 22



ADDITIONAL 23



ADDITIONAL 24

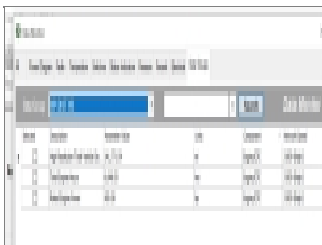

ADDITIONAL 25



Belt, Alignment, Condition & Adjustment



Belt & Engine Driven Components