



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSPECTOR: 5663
INSPECTION ID
139980

INSP DATE | VIN (LAST 8) | PO NUMBER
04/26/2021 | FW067171 |

Year	2015	Make	MCI
Model	J4500	VIN	2MG3JMB1FW067171

SPECIFICATION WORKSHEET

Interior Options	Steering Options
Interior Color: BLUE	Power Steering?: Yes

Engine Options A	
Eng Make:	CUMMINS
Eng Model:	ISX12
Eng Serial:	75038911
Eng HP:	425
Cruise:	Yes
Clean air idle:	Yes

Overall Condition	
Overall Length:	45
Overall Height:	140
Overall Width:	102

Engine Options B	
Odometer:	272964
Hub odometer:	
ECU HP:	425
ECU Miles:	272064
Eng Hours:	12588

Miscellaneous	
Seating Capacity:	56
Electronic Engine Controls:	Yes
Full Gauge Package:	Yes
Wraparound Dash:	Yes
Power Mirrors:	Yes
Tilt / Telescopic Steering Wheel:	Yes
AirRide Driver's Seat:	Yes
Restroom:	Yes
PA System:	Yes
Audio - Video System:	Yes
Number of Video Monitors:	6
Multi-Disc CD Changer:	No
Individual multi-Channel Audio System:	No
Global Positioning System:	No
In Motion Satellite TV System:	No
Road Viewing Monitor System:	No
Wheelchair Lift:	No
Underfloor Storage with Lift:	No
Parcel Rack Storage with Lift:	No
Traction Control:	Yes
Power Windshield Sun Visors:	Yes
Tour Guide Seat:	No
Other:	
Was Unit driven In ?:	Yes
Did Unit need to be jump started ?:	Yes
Was Unit towed in ?:	No
Did Unit start and run ?:	Yes
Unit Condition:	GOOD
If Unit is not driveable or will not start, Explain:	
Any extra options or features not listed on front page and any additional comments:	

Engine Options C	
Eng Brake:	JAKE
Fuel:	DIESEL
FT1 Capac (Gal):	NO TAG

Exterior Options A	
Air Horns:	SINGLE
Mirrors:	HEATED DUAL POWER
Exterior Color:	TAN

Axle / Susp Options	
WheelBase (In):	315
Rear Ratio:	COULD NOT READ TAG
F Axle (lbs):	16500
R Axle (lbs):	23000
GVWR (lbs):	54000
Suspension:	AIR RIDE
Tag Axle Capacity:	16500
Rear Axle Model:	COULD NOT READ TAG
Independent Front Suspension:	Yes
Full Coach Raise and Lowering Susp.:	Yes
Tag Axle Unloading System:	Yes
Front Susp. Kneeling System:	Yes

Transmission Options	
Trans Make:	ALLISON
Trans Model:	4000
Trans Speed:	6



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE 04/26/2021 VIN (LAST 8) FW067171 PO NUMBER

INSPECTOR: 5663
INSPECTION ID
139980

Brakes Options

ABS:	YES
HYD:	NO
AIR:	YES
DISK:	YES
DRUM:	NO
Brake Plates:	FRONT N / REAR N

Brakes











Steer Axle Brakes:	50%	50%	(1)
Drive Axle Brakes:	50%	50%	(2)
	50%	50%	(3)
			(4)
			(5)
			(6)

Tires [Front]

Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	HANCOOK

Tires [Rear]

Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	MISMATCHED

	STEER AXLE	DRIVE AXLE #1	DRIVE AXLE #2
		11 / 32nd HIGHWAY / V	15 / 32nd HIGHWAY / V
RIGHT	15 / 32nd HIGHWAY / V  F	 	 
FRONT		11 / 32nd HIGHWAY / V	/ 32nd /
		9 / 32nd HIGHWAY / V	/ 32nd /
LEFT	 11 / 32nd HIGHWAY / V	 	 
		10 / 32nd HIGHWAY / V	17 / 32nd HIGHWAY / V

Brake Legend

BD = DRUM HAS MORE THAN 1/16 INCH LIP
CL = CRACKED LINING
LS = LEAKING SEAL(S)

Tire Legend

C = CUT D = DRY ROT F = FLAT
M = MISMATCHED TIRES/CASING
MA = MISMATCHED AXLES (FRONT vs. REAR)
V = VIRGIN W = IRREGULAR WEAR
R = RECAP: 1 = ONCE, 2 = TWICE, 3 = 3 TIMES

Tread Legend

H = HIGHWAY L = LUG



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSPECTOR: 5663
INSPECTION ID
139980

INSP DATE | VIN (LAST 8) | PO NUMBER
04/26/2021 | FW067171 |

CONDITION REPORT

	Engine Compartment Area		COMMENTS	
X	Oil, Coolant and Other Fluid Leaks	CLASS 3 DRIP OIL LEAK AT OIL PAN		
X	Belt, Alignment, Condition & Adjustment		SQUEAKING	
	Operational Test		COMMENTS	
X	Batteries - Capable of Starting Engine		DEAD HAD TO JUMP OFF	
X	Seat Belts		DRIVER SEAT BELT PLASTIC TRIM LOOSE	
	In Cab Inspection		COMMENTS	
X	Windshield, Door & Any Other Glass		DRIVER WINDSHIELD CRACKED	
	Outside Inspection		COMMENTS	
X	Paint Condition & Physical Damage		BOTH SIDES OF REAR OF BUS DAMAGED /RIGHT FRONT OF BUS DAMAGED	
	Under Vehicle Inspection		COMMENTS	
	Tires/Wheels/Brakes		COMMENTS	
X	Tires/Wheels		RIGHT STEER AXLE TIRE FLAT/ DRIVER SIDE INNER DRIVE AXLE TIRE BELOW 10/32NDS	
Additional Services		Requested	Status	Comments



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE	VIN (LAST 8)	PO NUMBER
04/26/2021	FW067171	

INSPECTOR: 5663
INSPECTION ID
139980

RECONDITIONING AND SUPPLEMENTAL ESTIMATE

ITEM	DESCRIPTION / COMMENTS
Oil, Coolant and Other Fluid Leaks	X CLASS 3 DRIP OIL LEAK AT OIL PAN
Belt, Alignment, Condition & Adjustment	X SQUEAKING
Batteries - Capable of Starting Engine	X DEAD HAD TO JUMP OFF
Seat Belts	X DRIVER SEAT BELT PLASTIC TRIM LOOSE
Windshield, Door & Any Other Glass	X DRIVER WINDSHIELD CRACKED
Paint Condition & Physical Damage	X BOTH SIDES OF REAR OF BUS DAMAGED /RIGHT FRONT OF BUS DAMAGED
Tires/Wheels	X RIGHT STEER AXLE TIRE FLAT/ DRIVER SIDE INNER DRIVE AXLE TIRE BELOW 10/32NDS
DRIVER SEAT	AIR LEAK
PASSENGER SIDE MIRROR SWITCH	FAULTY
ACTIVE AND INACTIVE CODES	PRESENT

COMMENTS:



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE 04/26/2021 VIN (LAST 8) FW067171 PO NUMBER

INSPECTOR: 5663
INSPECTION ID
139980



VIN



DASH W/ STEERING WHEEL



LEFT SIDE



FRONT LEFT CORNER



FRONT OF BUS



FRONT RIGHT CORNER



RIGHT SIDE



REAR RIGHT CORNER



RIGHT REAR TIRES



REAR OF BUS



REAR LEFT CORNER



LEFT REAR TIRES



ENTRY WAY STEPS AT FRONT
DOOR



COMPLETE DRIVERS SEAT



ODOMETER



INSIDE OF BUS, FRONT TO
BACK



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE	VIN (LAST 8)	PO NUMBER
04/26/2021	FW067171	

INSPECTOR: 5663
INSPECTION ID
139980



FLOOR OF BUS, FRONT TO
BACK



INSIDE OF BUS, BACK TO
FRONT



FLOOR OF BUS, BACK TO
FRONT



INSIDE RESTROOM #1



INSIDE RESTROOM #2



SEATS



LEFT STEER TIRE



RIGHT STEER TIRE



ENGINE COMPARTMENT



ENGINE FAMILY NUMBER



ENGINE COMPARTMENT
RIGHT SIDE



ENGINE COMPARTMENT LEFT
SIDE



INSIDE STORAGE
COMPARTMENTS



ADDITIONAL 1



ADDITIONAL 2



ADDITIONAL 3



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE 04/26/2021 VIN (LAST 8) FW067171 PO NUMBER

INSPECTOR: 5663
INSPECTION ID
139980



ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 6



ADDITIONAL 7




ADDITIONAL 8



ADDITIONAL 9



ADDITIONAL 10

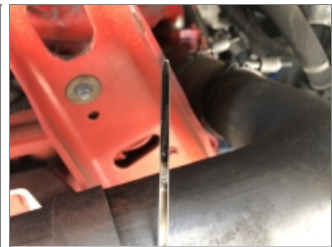

ADDITIONAL 11



ADDITIONAL 12



ADDITIONAL 13



ADDITIONAL 14



ADDITIONAL 15



ADDITIONAL 16



ADDITIONAL 17



ADDITIONAL 18



ADDITIONAL 19



INSP DATE	VIN (LAST 8)	PO NUMBER
04/26/2021	FW067171	

INSPECTOR: 5663
INSPECTION ID
139980

ADDITIONAL 20

ADDITIONAL 21

