



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

FLEET NAME

VIN (LAST 8)

PO NUMBER

03/04/2021

HW068245

INSPECTOR: 5420

INSPECTION ID

137500

Year	2017	Make	MCI
Model	J4500	VIN	2MG3JMBA5HW068245

SPECIFICATION WORKSHEET

Interior Options	
Interior Color:	BLUE

Steering Options	
Power Steering?:	Yes

Engine Options A	
Eng Make:	CUMMINS
Eng Model:	ISX12
Eng Serial:	75059264
Eng HP:	425
Cruise:	Yes
Clean air idle:	Yes

Overall Condition	
Overall Length:	45'
Overall Height:	11'6"
Overall Width:	102"

Engine Options B	
Odometer:	237325
Hub odometer:	N/A
ECU HP:	N/A
ECU Miles:	N/A
Eng Hours:	N/A

Miscellaneous	
Seating Capacity:	56
Electronic Engine Controls:	Yes
Full Gauge Package:	Yes
Wraparound Dash:	Yes
Power Mirrors:	Yes
Tilt / Telescopic Steering Wheel:	Yes
AirRide Driver's Seat:	Yes
Restroom:	Yes
PA System:	Yes
Audio - Video System:	Yes
Number of Video Monitors:	6
Multi-Disc CD Changer:	Yes
Individual multi-Channel Audio System:	No
Global Positioning System:	Yes
In Motion Satellite TV System:	No
Road Viewing Monitor System:	Yes
Wheelchair Lift:	No
Underfloor Storage with Lift:	No
Parcel Rack Storage with Lift:	No
Traction Control:	Yes
Power Windshield Sun Visors:	Yes
Tour Guide Seat:	No
Other:	N/A
Was Unit driven In ?:	Yes
Did Unit need to be jump started ?:	Yes
Was Unit towed in ?:	No
Did Unit start and run ?:	Yes
Unit Condition:	GOOD
If Unit is not driveable or will not start, Explain:	
Any extra options or features not listed on front page and any additional comments:	

Engine Options C	
Eng Brake:	JAKE
Fuel:	DIESEL
FT1 Capac (Gal):	222

Exterior Options A	
Air Horns:	DUAL
Mirrors:	HEATED DUAL POWER
Exterior Color:	WHITE

Axle / Susp Options	
WheelBase (In):	315
Rear Ratio:	N/A
F Axle (lbs):	17000
R Axle (lbs):	39500
GVWR (lbs):	54000
Suspension:	AIR RIDE
Tag Axle Capacity:	N/A
Rear Axle Model:	N/A
Independent Front Suspension:	No
Full Coach Raise and Lowering Susp.:	Yes
Tag Axle Unloading System:	Yes
Front Susp. Kneeling System:	Yes

Transmission Options	
Trans Make:	ALLISON
Trans Model:	3000/4000 5TH GEN
Trans Speed:	6



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT
 362 - Wells Fargo Equipment Management
 INSP DATE | FLEET NAME | VIN (LAST 8) | PO NUMBER
 03/04/2021 | | HW068245 |

INSPECTOR: 5420
 INSPECTION ID
 137500

Brakes Options	
ABS:	YES
HYD:	NO
AIR:	YES
DISK:	YES
DRUM:	NO
Brake Plates:	FRONT N / REAR N

Brakes			
Steer Axle Brakes:	60%	60%	(1)
Drive Axle Brakes:	60%	60%	(2)
	60%	60%	(3)
			(4)
			(5)
			(6)

Tires [Front]	
Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	HANK AL22 HV STEERS

Tires [Rear]	
Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	MAKE MIXED LV DRIVES

	STEER AXLE	DRIVE AXLE #1	DRIVE AXLE #2
RIGHT	16 / 32nd HIGHWAY / V	8 / 32nd LUG / V	8 / 32nd LUG / V
FRONT		8 / 32nd LUG / V	/ 32nd /
		8 / 32nd LUG / V	/ 32nd /
LEFT	14 / 32nd HIGHWAY / V		
		8 / 32nd LUG / V	8 / 32nd LUG / V

Brake Legend

BD = DRUM HAS MORE THAN 1/16 INCH LIP
CL = CRACKED LINING
LS = LEAKING SEAL(S)

Tire Legend

C = CUT D = DRY ROT F = FLAT
M = MISMATCHED TIRES/CASING
MA = MISMATCHED AXLES (FRONT vs. REAR)
V = VIRGIN W = IRREGULAR WEAR
R = RECAP: 1 = ONCE, 2 = TWICE, 3 = 3 TIMES

Tread Legend

H = HIGHWAY L = LUG



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/04/2021

FLEET NAME

VIN (LAST 8)

HW068245

PO NUMBER

INSPECTOR: 5420

INSPECTION ID

137500

CONDITION REPORT

	Engine Compartment Area	COMMENTS
OK	Fan Assembly, Shroud & Radiator	
OK	Hose Condition	
OK	Record Coolant Protection Level	-30
OK	Oil in Cooling System	
OK	Coolant DCA Level	
OK	Coolant Level	
OK	Power/Manual Steering Fluid Level	
N/A	Clutch Master Cylinder Fluid Level	
N/A	Brake Fluid Level	
OK	Engine Oil Level	
OK	Oil, Coolant and Other Fluid Leaks	
OK	Belt, Alignment, Condition & Adjustment	
OK	Belt & Engine Driven Components	
OK	Exhaust & Intake Systems	
OK	Visible Inspection of Starter	
N/A	Other	

	Operational Test	COMMENTS
X	Batteries - Capable of Starting Engine	DEAD NEEDED JUMP START
OK	Starter Condition	
OK	Steering Free Play	
N/A	Clutch & Clutch Brake	
OK	Transmission Shifts	
OK	Brakes & Parking Brakes	
OK	Throttle	
OK	Engine Brake	
OK	Air Pressure Build Up	120
OK	Governed Air Pressure (psi)	
OK	Low Air Warning	
OK	Gauges	
X	Engine Warning System	ECU/JPRO SYSTEM WILL NOT FULLY CONNECT
OK	Seat Belts	
OK	HVAC System	
OK	Record A/C Temperature	
OK	Windshield Wipers & Washers	
OK	Horns	
OK	Door Locks & Latches	
OK	Window Operation	
N/A	Other	

	In Cab Inspection	COMMENTS
X	Windshield, Door & Any Other Glass	RIGHT WINDSHIELD CRACKED
OK	Interior Condition/ Seats, Panels, Etc.	
OK	DOT Required Safety Equipment	
N/A	Other	

	Outside Inspection	COMMENTS
X	Paint Condition & Physical Damage	EXTERIOR FRONT LEFT PANEL SCRATCHED
OK	Mirrors	
OK	Lights and Reflectors	
OK	Fuel Tank Mounting & Condition	
X	Batteries & Battery Box	BATTERIES DEAD
OK	Intake & Exhaust Mounting & Condition	
N/A	Other	

Under Vehicle Inspection		COMMENTS
OK	Kingpins/Steering Components	
OK	Engine/Transmission Mounts	
OK	Frame, Crossmembers, Fasteners	
OK	Cab Mounts	
OK	Driveshafts, U-joints, Yokes	
N/A	Hydraulic Brake Lines & Components	
OK	Brake Hoses for Chafing & Cracking	
OK	Air Brake Components	
OK	Transmission & Differential Fluid Levels	
OK	Transmission & Differential Leaks	
OK	Air Leaks	
OK	Suspension Condition	
N/A	Other	

Tires/Wheels/Brakes		COMMENTS
X	Tires/Wheels	ALL DRIVE TIRES AND TAG AXLE TIRES BELOW 10/32ND THREAD DEPTH
OK	Brakes	

Additional Services	Requested	Status	Comments



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/04/2021

FLEET NAME

VIN (LAST 8)

HW068245

PO NUMBER

INSPECTOR: 5420

INSPECTION ID

137500

RECONDITIONING AND SUPPLEMENTAL ESTIMATE

ITEM	DESCRIPTION / COMMENTS
Batteries - Capable of Starting Engine	X DEAD NEEDED JUMP START
Engine Warning System	X ECU/JPRO SYSTEM WILL NOT FULLY CONNECT
Windshield, Door & Any Other Glass	X RIGHT WINDSHIELD CRACKED
Paint Condition & Physical Damage	X EXTERIOR FRONT LEFT PANEL SCRATCHED
Batteries & Battery Box	X BATTERIES DEAD
Tires/Wheels	X ALL DRIVE TIRES AND TAG AXLE TIRES BELOW 10/32ND THREAD DEPTH

COMMENTS:



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

FLEET NAME

VIN (LAST 8)

PO NUMBER

03/04/2021

HW068245

INSPECTOR: 5420

INSPECTION ID

137500



VIN



DASH W/ STEERING WHEEL



LEFT SIDE



FRONT LEFT CORNER



FRONT OF BUS



FRONT RIGHT CORNER



RIGHT SIDE



REAR RIGHT CORNER



RIGHT REAR TIRES



REAR OF BUS



REAR LEFT CORNER



LEFT REAR TIRES



ENTRY WAY STEPS AT FRONT DOOR



COMPLETE DRIVERS SEAT



ODOMETER



DASH HOUR METER



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/04/2021

FLEET NAME

VIN (LAST 8)

HW068245

PO NUMBER

INSPECTOR: 5420

INSPECTION ID

137500



INSIDE OF BUS, FRONT TO BACK



FLOOR OF BUS, FRONT TO BACK



INSIDE OF BUS, BACK TO FRONT



FLOOR OF BUS, BACK TO FRONT



INSIDE RESTROOM #1



INSIDE RESTROOM #2



SEATS



LEFT STEER TIRE



RIGHT STEER TIRE



ENGINE COMPARTMENT



ENGINE FAMILY NUMBER



ENGINE COMPARTMENT
RIGHT SIDE



ENGINE COMPARTMENT LEFT
SIDE



INSIDE STORAGE
COMPARTMENTS



ADDITIONAL 1



ADDITIONAL 2



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

FLEET NAME

VIN (LAST 8)

PO NUMBER

03/04/2021

HW068245

INSPECTOR: 5420

INSPECTION ID

137500



ADDITIONAL 3




ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 6

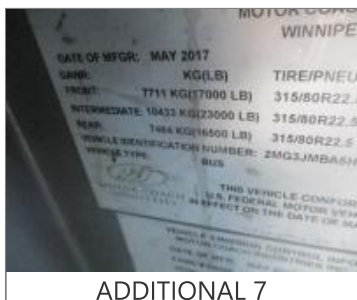

ADDITIONAL 7



ADDITIONAL 8




ADDITIONAL 9



ADDITIONAL 10




ADDITIONAL 11

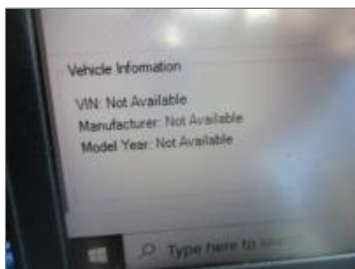

ADDITIONAL 12



ADDITIONAL 13

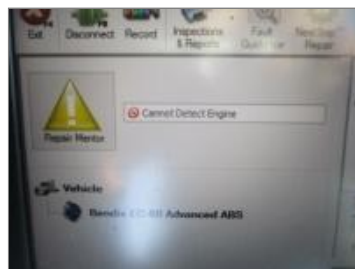

ADDITIONAL 14



ADDITIONAL 15



ADDITIONAL 16



ADDITIONAL 17



ADDITIONAL 18



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/04/2021

FLEET NAME

VIN (LAST 8)

HW068245

PO NUMBER

INSPECTOR: 5420

INSPECTION ID

137500



ADDITIONAL 19



ADDITIONAL 20



ADDITIONAL 21