



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

09/21/2020

FLEET NAME

TD925

VIN (LAST 8)

92042430

PO NUMBER

INSPECTOR: 2242

INSPECTION ID

125914

Year	2009	Make	VAN HOOL
Model	TD925	VIN	YE2DG11BX92042430

SPECIFICATION WORKSHEET

Interior Options	
Interior Color:	BULE / RED

Steering Options	
Power Steering?:	Yes

Engine Options A	
Eng Make:	CUMMINS
Eng Model:	Cummins ISM
Eng Serial:	
Eng HP:	450
Cruise:	Yes
Clean air idle:	No

Overall Condition	
Overall Length:	44' 4
Overall Height:	13' 1
Overall Width:	102

Engine Options B	
Odometer:	325589
Hub odometer:	
ECU HP:	450
ECU Miles:	
Eng Hours:	

Miscellaneous	
Seating Capacity:	81
Electronic Engine Controls:	Yes
Full Gauge Package:	Yes
Wraparound Dash:	No
Power Mirrors:	Yes
Tilt / Telescopic Steering Wheel:	Yes
AirRide Driver's Seat:	Yes
Restroom:	Yes
PA System:	
Audio - Video System:	Yes
Number of Video Monitors:	2
Multi-Disc CD Changer:	No
Individual multi-Channel Audio System:	No
Global Positioning System:	No
In Motion Satellite TV System:	No
Road Viewing Monitor System:	No
Wheelchair Lift:	No
Underfloor Storage with Lift:	No
Parcel Rack Storage with Lift:	No
Traction Control:	No
Power Windshield Sun Visors:	No
Tour Guide Seat:	No
Other:	
Was Unit driven In ?:	Yes
Did Unit need to be jump started ?:	No
Was Unit towed in ?:	No
Did Unit start and run ?:	Yes
Unit Condition:	GOOD
If Unit is not driveable or will not start, Explain:	
Any extra options or features not listed on front page and any additional comments:	

Engine Options C	
Eng Brake:	NONE
Fuel:	DIESEL
FT1 Capac (Gal):	166

Exterior Options A	
Air Horns:	DUAL
Mirrors:	DUAL POWER
Exterior Color:	burgubdy

Axle / Susp Options	
WheelBase (In):	242
Rear Ratio:	3.42
F Axle (lbs):	18180
R Axle (lbs):	27575
GVWR (lbs):	62,000
Suspension:	AIR RIDE
Tag Axle Capacity:	18180
Rear Axle Model:	NO TAG
Independent Front Suspension:	No
Full Coach Raise and Lowering Susp.:	No
Tag Axle Unloading System:	No
Front Susp. Kneeling System:	Yes

Transmission Options	
Trans Make:	ZF
Trans Model:	AS Tronic
Trans Speed:	12



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

09/21/2020

FLEET NAME

VIN (LAST 8)

PO NUMBER

92042430

INSPECTOR: 2242

INSPECTION ID

125914

Brakes Options

ABS:	YES
HYD:	NO
AIR:	YES
DISK:	NO
DRUM:	YES
Brake Plates:	FRONT N / REAR N

Brakes

Steer Axle Brakes:	60%	60%	(1)
Drive Axle Brakes:	60%	60%	(2)
	60%	60%	(3)
			(4)
			(5)
			(6)

Tires [Front]

Size:	
Wheels:	
Detail:	

Tires [Rear]

Size:	
Wheels:	
Detail:	

	STEER AXLE	DRIVE AXLE #1	DRIVE AXLE #2
		7 / 32nd HIGHWAY / R1	0 / 32nd HIGHWAY /
RIGHT	16 / 32nd / 	 	  W
FRONT		8 / 32nd HIGHWAY /	/ 32nd /
		21 / 32nd HIGHWAY /	/ 32nd /
LEFT	 13 / 32nd HIGHWAY /	 	  W
		21 / 32nd HIGHWAY / R1	0 / 32nd HIGHWAY /

Brake Legend

BD = DRUM HAS MORE THAN 1/16 INCH LIP
CL = CRACKED LINING
LS = LEAKING SEAL(S)

Tire Legend

C = CUT D = DRY ROT F = FLAT
M = MISMATCHED TIRES/CASING
MA = MISMATCHED AXLES (FRONT vs. REAR)
V = VIRGIN W = IRREGULAR WEAR
R = RECAP: 1 = ONCE, 2 = TWICE, 3 = 3 TIMES

Tread Legend

H = HIGHWAY L = LUG



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

09/21/2020

FLEET NAME

VIN (LAST 8)

PO NUMBER

92042430

INSPECTOR: 2242

INSPECTION ID

125914

CONDITION REPORT

	Engine Compartment Area	COMMENTS
X	Fan Assembly, Shroud & Radiator	radiator dirty on core outside
OK	Hose Condition	
OK	Record Coolant Protection Level	
N/A	Oil in Cooling System	
OK	Coolant DCA Level	
OK	Coolant Level	
OK	Power/Manual Steering Fluid Level	
OK	Clutch Master Cylinder Fluid Level	
OK	Brake Fluid Level	
OK	Engine Oil Level	
N/A	Oil, Coolant and Other Fluid Leaks	
OK	Belt, Alignment, Condition & Adjustment	good
OK	Belt & Engine Driven Components	
OK	Exhaust & Intake Systems	
OK	Visible Inspection of Starter	
	Other	
	Operational Test	COMMENTS
OK	Batteries - Capable of Starting Engine	
OK	Starter Condition	
OK	Steering Free Play	
N/A	Clutch & Clutch Brake	
OK	Transmission Shifts	
OK	Brakes & Parking Brakes	
OK	Throttle	
N/A	Engine Brake	
OK	Air Pressure Build Up	
OK	Governed Air Pressure (psi)	
OK	Low Air Warning	
OK	Gauges	
OK	Engine Warning System	
OK	Seat Belts	
OK	HVAC System	
OK	Record A/C Temperature	
X	Windshield Wipers & Washers	right washer in-op
OK	Horns	
X	Door Locks & Latches	at times will not open
OK	Window Operation	
	Other	
	In Cab Inspection	COMMENTS
OK	Windshield, Door & Any Other Glass	
OK	Interior Condition/ Seats, Panels, Etc.	
OK	DOT Required Safety Equipment	
	Other	
	Outside Inspection	COMMENTS
OK	Paint Condition & Physical Damage	
X	Mirrors	left right left only right no adjustment
OK	Lights and Reflectors	
OK	Fuel Tank Mounting & Condition	
OK	Batteries & Battery Box	
OK	Intake & Exhaust Mounting & Condition	
	Other	
	Under Vehicle Inspection	COMMENTS
OK	Kingpins/Steering Components	visual
OK	Engine/Transmission Mounts	
OK	Frame, Crossmembers, Fasteners	
OK	Cab Mounts	
OK	Driveshafts, U-joints, Yokes	
OK	Hydraulic Brake Lines & Components	
OK	Brake Hoses for Chafing & Cracking	
OK	Air Brake Components	
OK	Transmission & Differential Fluid Levels	
OK	Transmission & Differential Leaks	
OK	Air Leaks	
OK	Suspension Condition	
OK	Other	
	Tires/Wheels/Brakes	COMMENTS
X	Tires/Wheels	4 REAR TIRES UNDER 10/32
OK	Brakes	

Additional Services	Requested	Status	Comments
---------------------	-----------	--------	----------



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

09/21/2020

FLEET NAME

VIN (LAST 8)

92042430

PO NUMBER

INSPECTOR: 2242

INSPECTION ID

125914

RECONDITIONING AND SUPPLEMENTAL ESTIMATE

ITEM	DESCRIPTION / COMMENTS
Fan Assembly, Shroud & Radiator	X radiator dirty on core outside
Windshield Wipers & Washers	X right washer in-op
Door Locks & Latches	X at times will not open
Mirrors	X left right left only right no adjustment
Tires/Wheels	X 4 REAR TIRES UNDER 10/32
HANDEL BROKEN	
RIGHT REAR BODY DAMAGE	
CLASS 3 LEAK AROUND TOP OF ENGINE	
FRONT BUMPER	DAMAGED
DE-ID	REMOVE DECALS

COMMENTS:

UNABLE TO CONNECT TO ECM



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

09/21/2020

FLEET NAME

VIN (LAST 8)


PO NUMBER

92042430

INSPECTOR: 2242

INSPECTION ID

125914

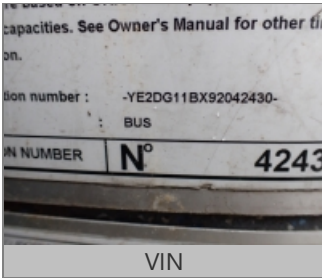

VIN



DATA TAG



DATA TAG



LEFT SIDE



LEFT FRONT



FRONT



RIGHT FRONT



RIGHT SIDE



RIGHT SIDE



RIGHT REAR




RIGHT REAR



RIGHT REAR



REAR

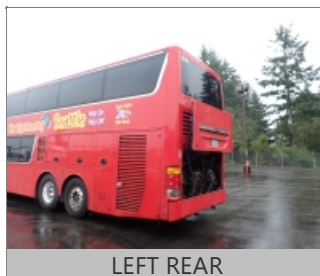

LEFT REAR



LEFT SIDE



MILEAGE



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

09/21/2020

FLEET NAME

VIN (LAST 8)

PO NUMBER

92042430

INSPECTOR: 2242

INSPECTION ID

125914



INTERIOR SEATS



DRIVER SEAT



INTERIOR SEATS



INTERIOR SEATS



INTERIOR SEATS



STEER TIRE



ENGINE



1



2



3



BROKEN HANDEL



UNDER BODY



WIRING



AIR GAUGE



4



Tire



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

09/21/2020

FLEET NAME

VIN (LAST 8)

PO NUMBER

92042430

INSPECTOR: 2242

INSPECTION ID

125914



ODOMETER



OLD DOT



ADDITIONAL 4



5



REAR DAMAGE



TAG



STOREAGE



7



8



ENGINE COMPARTMENT



ENGINE FAMILY NUMBER



ENGINE COMPARTMENT LEFT SIDE



9



10



ADDITIONAL 1



ADDITIONAL 2



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

09/21/2020

FLEET NAME

VIN (LAST 8)

PO NUMBER

92042430

INSPECTOR: 2242

INSPECTION ID

125914



ADDITIONAL 3



ADDITIONAL 9



ADDITIONAL 17



ADDITIONAL 19



ADDITIONAL 20



ADDITIONAL 21



ADDITIONAL 22



ADDITIONAL 23



ADDITIONAL 24



ADDITIONAL 25



ADDITIONAL 26



ADDITIONAL 27



ADDITIONAL 28



ADDITIONAL 29



ADDITIONAL 30



ADDITIONAL 31



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

09/21/2020

FLEET NAME

VIN (LAST 8)

PO NUMBER

92042430

INSPECTOR: 2242

INSPECTION ID

125914





DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

09/21/2020

FLEET NAME

VIN (LAST 8)

PO NUMBER

92042430

INSPECTOR: 2242

INSPECTION ID

125914



ADDITIONAL 50



ADDITIONAL 51



ADDITIONAL 52



ADDITIONAL 53



ADDITIONAL 55



ADDITIONAL 56



ADDITIONAL 57



ADDITIONAL 58



ADDITIONAL 59



ADDITIONAL 100