



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE	FLEET NAME	VIN (LAST 8)	PO NUMBER
03/16/2021		J5189085	

INSPECTOR: 5932

INSPECTION ID

138049

Year	2018	Make	VOLVO
Model	9700	VIN	3CET2V924J5189085

SPECIFICATION WORKSHEET

Interior Options

Interior Color:	BLACK
-----------------	-------

Steering Options

Power Steering?:	Yes
------------------	-----

Engine Options A

Eng Make:	VOLVO
Eng Model:	D13
Eng Serial:	NA
Eng HP:	435
Cruise:	Yes
Clean air idle:	Yes

Overall Condition

Overall Length:	45'
Overall Height:	12'
Overall Width:	8'

Engine Options B

Odometer:	159823
Hub odometer:	NA
ECU HP:	500
ECU Miles:	159830
Eng Hours:	NA

Miscellaneous

Seating Capacity:	56
Electronic Engine Controls:	Yes
Full Gauge Package:	Yes
Wraparound Dash:	Yes
Power Mirrors:	Yes
Tilt / Telescopic Steering Wheel:	Yes
AirRide Driver's Seat:	Yes
Restroom:	Yes
PA System:	Yes
Audio - Video System:	Yes
Number of Video Monitors:	4
Multi-Disc CD Changer:	No
Individual multi-Channel Audio System:	No
Global Positioning System:	Yes
In Motion Satellite TV System:	No
Road Viewing Monitor System:	Yes
Wheelchair Lift:	No
Underfloor Storage with Lift:	No
Parcel Rack Storage with Lift:	No
Traction Control:	Yes
Power Windshield Sun Visors:	Yes
Tour Guide Seat:	No
Other:	NA
Was Unit driven In ?:	Yes
Did Unit need to be jump started ?:	No
Was Unit towed in ?:	No
Did Unit start and run ?:	Yes
Unit Condition:	GOOD
If Unit is not driveable or will not start, Explain:	NA
Any extra options or features not listed on front page and any additional comments:	NA

Engine Options C

Eng Brake:	JAKE
Fuel:	DIESEL
FT1 Capac (Gal):	211

Exterior Options A

Air Horns:	NONE
Mirrors:	DUAL POWER
Exterior Color:	WHITE

Axle / Susp Options

WheelBase (In):	315
Rear Ratio:	2.64
F Axle (lbs):	16,500
R Axle (lbs):	10,800
GVWR (lbs):	49,400
Suspension:	AIR RIDE
Tag Axle Capacity:	22,100
Rear Axle Model:	NA
Independent Front Suspension:	Yes
Full Coach Raise and Lowering Susp.:	Yes
Tag Axle Unloading System:	Yes
Front Susp. Kneeling System:	Yes

Transmission Options

Trans Make:	ALLISON
Trans Model:	3000/4000 5TH GEN
Trans Speed:	12



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/16/2021

FLEET NAME

VIN (LAST 8)

PO NUMBER

J5189085

INSPECTOR: 5932

INSPECTION ID

138049

Brakes Options

ABS:	YES
HYD:	NO
AIR:	YES
DISK:	YES
DRUM:	NO
Brake Plates:	FRONT N / REAR N

Brakes

Steer Axle Brakes:	50%	50%	(1)
Drive Axle Brakes:	50%	50%	(2)
	50%	50%	(3)
			(4)
			(5)
			(6)

Tires [Front]

Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	

Tires [Rear]

Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	

	STEER AXLE	DRIVE AXLE #1	DRIVE AXLE #2
		2 / 32nd LUG / R1	10 / 32nd LUG / R1
RIGHT	9 / 32nd HIGHWAY / V 	 	 
FRONT		12 / 32nd LUG / R1	/ 32nd /
LEFT	 4 / 32nd HIGHWAY / V	 	 / 32nd /
		7 / 32nd LUG / R1	9 / 32nd LUG / R1

Brake Legend

BD = DRUM HAS MORE THAN 1/16 INCH LIP
CL = CRACKED LINING
LS = LEAKING SEAL(S)

Tire Legend

C = CUT D = DRY ROT F = FLAT
M = MISMATCHED TIRES/CASING
MA = MISMATCHED AXLES (FRONT vs.
REAR)
V = VIRGIN W = IRREGULAR WEAR
R = RECAP: 1 = ONCE, 2 = TWICE, 3 = 3 TIMES

Tread Legend

H = HIGHWAY L = LUG



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/16/2021

FLEET NAME

VIN (LAST 8)

PO NUMBER

J5189085

INSPECTOR: 5932

INSPECTION ID

138049

CONDITION REPORT

	Engine Compartment Area	COMMENTS
	Operational Test	COMMENTS
	In Cab Inspection	COMMENTS
X	Windshield, Door & Any Other Glass	RIGHT WINDSHIELD CHIP
	Outside Inspection	COMMENTS
X	Paint Condition & Physical Damage	BODY DAMAGE
	Under Vehicle Inspection	COMMENTS
	Tires/Wheels/Brakes	COMMENTS
X	Tires/Wheels	5 TIRES BELOW 10/32

Additional Services	Requested	Status	Comments
---------------------	-----------	--------	----------



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/16/2021

FLEET NAME

VIN (LAST 8)

PO NUMBER

J5189085

INSPECTOR: 5932

INSPECTION ID

138049

RECONDITIONING AND SUPPLEMENTAL ESTIMATE

ITEM	DESCRIPTION / COMMENTS
Windshield, Door & Any Other Glass	X RIGHT WINDSHIELD CHIP
Paint Condition & Physical Damage	X BODY DAMAGE
Tires/Wheels	X 5 TIRES BELOW 10/32
FRONT BUMPER	DAMAGED
FRONT PANEL	REFINISH
ENTRY DOOR	REFINISH
LEFT SIDE # 1 CARGO DOOR	DAMAGED
RIGHT SIDE ENGINE DOOR	DAMAGED
REAR BUMPER RIGHT END CAP	DAMAGED

COMMENTS:

THE COACH WAS INSPECTED AT THE CUSTOMER'S YARD. THE COACH WAS IN GOOD RUNNING CONDITION. THERE WAS DAMAGE TO THE FRONT BUMPER, RIGHT WINDSHIELD, FRONT PANEL, ENTRY DOOR, RIGHT SIDE, LEFT SIDE AND THE REAR BUMPER. THERE WERE ALSO FOUR BAD TIRES. TWENTY SIX OUTLETS WITH USB PORTS.



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/16/2021

FLEET NAME

VIN (LAST 8)

J5189085

PO NUMBER

INSPECTOR: 5932

INSPECTION ID

138049



VIN



DASH W/ STEERING WHEEL



LEFT SIDE



FRONT LEFT CORNER



FRONT OF BUS



FRONT RIGHT CORNER



RIGHT SIDE



REAR RIGHT CORNER



RIGHT REAR TIRES



REAR OF BUS



REAR LEFT CORNER



LEFT REAR TIRES



ENTRY WAY STEPS AT FRONT
DOOR



COMPLETE DRIVERS SEAT



ODOMETER



INSIDE OF BUS, FRONT TO
BACK



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/16/2021

FLEET NAME

VIN (LAST 8)

PO NUMBER

J5189085

INSPECTOR: 5932

INSPECTION ID

138049



FLOOR OF BUS, FRONT TO BACK




INSIDE OF BUS, BACK TO FRONT



FLOOR OF BUS, BACK TO FRONT



INSIDE RESTROOM #1

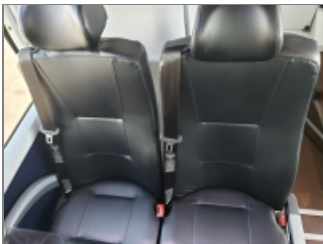

SEATS



LEFT STEER TIRE



RIGHT STEER TIRE



ENGINE COMPARTMENT



ENGINE FAMILY NUMBER




ENGINE COMPARTMENT
RIGHT SIDE



ENGINE COMPARTMENT LEFT
SIDE



INSIDE STORAGE
COMPARTMENTS

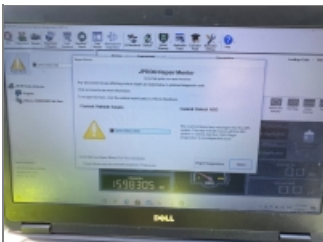

J PRO SCREEN



CUP HOLDERS



OUTLETS USB PORTS



ADDITIONAL 1



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

CLIENT

362 - Wells Fargo Equipment Management

INSP DATE

03/16/2021

FLEET NAME

VIN (LAST 8)

PO NUMBER

J5189085

INSPECTOR: 5932

INSPECTION ID

138049



ADDITIONAL 2



ADDITIONAL 3



ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 6



ADDITIONAL 7



ADDITIONAL 8



ADDITIONAL 9