



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSPECTOR: 6224
 INSPECTION ID
 144744

INSP DATE | VIN (LAST 8) | PO NUMBER
 08/05/2021 | JW068655 |

Year: 2018 Make: MCI
 Model: J4500 VIN: 2MG3JMB5JW068655

SPECIFICATION WORKSHEET

Interior Options	
Interior Color:	BLUE

Steering Options	
Power Steering?:	Yes

Engine Options A	
Eng Make:	CUMMINS
Eng Model:	ISX12 425MC
Eng Serial:	75066517
Eng HP:	425
Cruise:	Yes
Clean air idle:	No

Overall Condition	
Overall Length:	45.58 ft
Overall Height:	140.75 in
Overall Width:	102.00 in

Engine Options B	
Odometer:	214007
Hub odometer:	N/A
ECU HP:	
ECU Miles:	
Eng Hours:	213974

Miscellaneous	
Seating Capacity:	56
Electronic Engine Controls:	Yes
Full Gauge Package:	Yes
Wraparound Dash:	No
Power Mirrors:	Yes
Tilt / Telescopic Steering Wheel:	Yes
AirRide Driver's Seat:	Yes
Restroom:	Yes
PA System:	Yes
Audio - Video System:	Yes
Number of Video Monitors:	6
Multi-Disc CD Changer:	No
Individual multi-Channel Audio System:	No
Global Positioning System:	No
In Motion Satellite TV System:	No
Road Viewing Monitor System:	No
Wheelchair Lift:	No
Underfloor Storage with Lift:	No
Parcel Rack Storage with Lift:	No
Traction Control:	Yes
Power Windshield Sun Visors:	No
Tour Guide Seat:	No
Other:	EVERY SEAT HAD A 110 VOLT PLUG WITH USB HOOKUP, AND EACH SEAT BACK HAD A FOLD DOWN TRAY
Was Unit driven In ?:	Yes
Did Unit need to be jump started ?:	No
Was Unit towed in ?:	No
Did Unit start and run ?:	Yes
Unit Condition:	FAIR
If Unit is not driveable or will not start, Explain:	AT THE TIME OF INSPECTION THE BUS WAS EXTREMELY LOW ON FUEL,

Engine Options C	
Eng Brake:	EXHAUST
Fuel:	DIESEL
FT1 Capac (Gal):	189

Exterior Options A	
Air Horns:	NONE
Mirrors:	DUAL POWER
Exterior Color:	WHITE

Axle / Susp Options	
WheelBase (In):	315.00 in
Rear Ratio:	
F Axle (lbs):	17,000 LB
R Axle (lbs):	28,000 LB
GVWR (lbs):	54,000 LB
Suspension:	AIR RIDE
Tag Axle Capacity:	ZF RL 80 E 17,000LB
Rear Axle Model:	ZF A 132 28,000LB
Independent Front Suspension:	Yes
Full Coach Raise and Lowering Susp.:	Yes
Tag Axle Unloading System:	No
Front Susp. Kneeling System:	Yes

Transmission Options	
Trans Make:	ALLISON
Trans Model:	ALLISON B500
Trans Speed:	6 SPD

Any extra options or features not listed on front page and any additional comments:



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSPECTOR: 6224
 INSPECTION ID
 144744

INSP DATE | VIN (LAST 8) | PO NUMBER
 08/05/2021 | JW068655 |

Brakes Options	
ABS:	YES
HYD:	NO
AIR:	YES
DISK:	YES
DRUM:	NO
Brake Plates:	FRONT N / REAR N

Brakes			
Steer Axle Brakes:	60%	60%	(1)
Drive Axle Brakes:	60%	60%	(2)
	60%	60%	(3)
			(4)
			(5)
			(6)

Tires [Front]	
Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	

Tires [Rear]	
Size:	315/80 R22.5
Wheels:	ALUMINUM
Detail:	

	STEER AXLE	DRIVE AXLE #1	DRIVE AXLE #2
RIGHT	11 / 32nd HIGHWAY / V	10 / 32nd LUG / V	11 / 32nd LUG / V
FRONT		12 / 32nd LUG / V	/ 32nd /
		12 / 32nd LUG / V	/ 32nd /
LEFT	11 / 32nd HIGHWAY / V		
		12 / 32nd LUG / V	11 / 32nd LUG / V

Brake Legend

BD = DRUM HAS MORE THAN 1/16 INCH LIP
 CL = CRACKED LINING
 LS = LEAKING SEAL(S)

Tire Legend

C = CUT D = DRY ROT F = FLAT
 M = MISMATCHED TIRES/CASING
 MA = MISMATCHED AXLES (FRONT vs. REAR)
 V = VIRGIN W = IRREGULAR WEAR
 R = RECAP: 1 = ONCE, 2 = TWICE, 3 = 3 TIMES

Tread Legend

H = HIGHWAY L = LUG



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSPECTOR: 6224
INSPECTION ID
144744

INSP DATE | **VIN (LAST 8)** | **PO NUMBER**
 08/05/2021 | JW068655 |

CONDITION REPORT

Engine Compartment Area		COMMENTS	
X	Power/Manual Steering Fluid Level	OVER FILLED	
X	Engine Oil Level	LOW	
X	Oil, Coolant and Other Fluid Leaks	SEEPAGE OIL PAN UNABLE TO GET CLEAR PHOTO	
Operational Test		COMMENTS	
In Cab Inspection		COMMENTS	
X	DOT Required Safety Equipment	NONE SEEN	
Outside Inspection		COMMENTS	
X	Mirrors	SOME SCRATCHES	
Under Vehicle Inspection		COMMENTS	
X	Transmission & Differential Fluid Levels	TRANS FLUID LOW	
Tires/Wheels/Brakes		COMMENTS	
X	Tires/Wheels	IRREGULAR TIRE WEAR	
Additional Services	Requested	Status	Comments



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSPECTOR: 6224
INSPECTION ID
144744

INSP DATE | **VIN (LAST 8)** | **PO NUMBER**
08/05/2021 | JW068655 |

RECONDITIONING AND SUPPLEMENTAL ESTIMATE

ITEM	DESCRIPTION / COMMENTS
Power/Manual Steering Fluid Level	X OVER FILLED
Engine Oil Level	X LOW
Oil, Coolant and Other Fluid Leaks	X SEEPAGE OIL PAN UNABLE TO GET CLEAR PHOTO
DOT Required Safety Equipment	X NONE SEEN
Mirrors	X SOME SCRATCHES
Transmission & Differential Fluid Levels	X TRANS FLUID LOW
Tires/Wheels	X IRREGULAR TIRE WEAR

COMMENTS:



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSPECTOR: 6224
INSPECTION ID
144744

INSP DATE | **VIN (LAST 8)** | **PO NUMBER**
 08/05/2021 | JW068655 |



VIN



DASH W/ STEERING WHEEL




FRONT LEFT CORNER



FRONT OF BUS




FRONT RIGHT CORNER

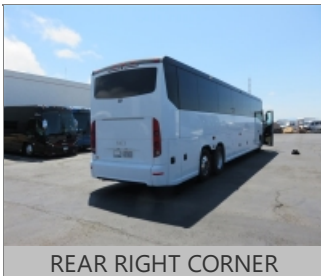

REAR RIGHT CORNER



RIGHT REAR TIRES

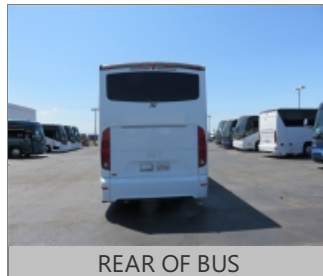

REAR OF BUS



REAR LEFT CORNER



LEFT REAR TIRES



ENTRY WAY STEPS AT FRONT DOOR



COMPLETE DRIVERS SEAT



ODOMETER



INSIDE OF BUS, FRONT TO BACK



FLOOR OF BUS, FRONT TO BACK



INSIDE OF BUS, BACK TO FRONT



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE | VIN (LAST 8) | PO NUMBER
 08/05/2021 | JW068655

INSPECTOR: 6224
 INSPECTION ID
 144744



FLOOR OF BUS, BACK TO FRONT



INSIDE RESTROOM #1



SEATS



LEFT STEER TIRE



RIGHT STEER TIRE



ENGINE COMPARTMENT



ENGINE FAMILY NUMBER



ENGINE COMPARTMENT
RIGHT SIDE



ENGINE COMPARTMENT LEFT
SIDE



INSIDE STORAGE
COMPARTMENTS



ADDITIONAL 1



ADDITIONAL 2



ADDITIONAL 3



ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 6



DEKRA Services Inc.
Customer Service 770-257-0107

BUS

INSP DATE	VIN (LAST 8)	PO NUMBER
08/05/2021	JW068655	

INSPECTOR: 6224
INSPECTION ID
144744



ADDITIONAL 12